· PAGE: 1

PRINT DATE: 11/21/91

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CRITICAL HARDWARE

NUMBER: 04-2-\$17C-IM-X

\$050276 ATTACHMEN PAGE 28 G

SUBSYSTEM NAME: AUXILIARY POWER UNIT (APU)

REVISION: 3 11/21/91

PART NAME VENDOR NAME PART NUMBER VENDOR NUMBER

■ LRU :

AUXILIARY POWER UNIT (APU)

MC201-0001-04XX

SUNDSTRAND

X742211X

■ SRU

THERMOSTAT

SUNDSTRAND DATA CONTROLS

5908109

975-0478-003

PART DATA

- EXTENDED DESCRIPTION OF PART UNDER ANALYSIS: THERMOSTAT, OVERTEMPERATURE, APU FUEL PUMP/VALVE (GGVM)/FUEL LINES (FEED, BYPASS, REFERENCE) SUPPLY
- QUANTITY OF LIKE ITEMS: 6 1 FOR HEATER ELEMENT A AND ONE FOR HEATER ELEMENT 8, 2 PER APU
- FUNCTION:

TO PROVIDE A CLOSED ELECTRICAL CIRCUIT AT A MINIMUM OF 120 DEG F AND AN OPEN CIRCUIT AT A MAXIMUM OF 140 DEG F. DIFFERENTIAL BETWEEN OPENING AND CLOSING TEMPERATURE IS REQUIRED TO BE AT LEAST 7 DEG F. EACH OVERTEMPERATURE THERMOSTAT (\$176/5170) CONTROLS ONE OF THE REDUNDANT ELEMENTS (HEATER A/HEATER B) OF THE APU FUEL PUMP. GGVM AND FUEL LINE HEATERS (REFERENCE FMEA 04-2-HR17) IN THE EVENT THAT THE CONTROL THERMOSTAT (SIZA/SIZB) FAILS CLOSED.

5X76/5X7D

PRINT DATE: 11/21/91

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CRITICAL FAILURE MODE

NUMBER: 04-2-517C-IM-01

505 ATTACHIER PAGE 29 c

SUBSYSTEM: AUXILIARY POWER UNIT (APU)

LRU :AUXILIARY POWER UNIT (APU) ITEM MAME: THERMOSTAT

REVISION# 3 11/21/91 R

CRITICALITY OF THIS FAILURE MODE: 1R2

m FAILURE MODE:

FAILS TO CLOSE (FAILS OPEN)

MISSION PHASE:

PRELAUNCH PL LÓ LIFT-OFF 00 ON-ORBIT

DO DE-ORBIT

■ VEHICLE/PAYLOAD/KIT EFFECTIVITY: 102

: 103 DISCOVERY

: 104

: 105 ENDEAVOUR

CAUSE: INTERNAL PIECE-PART FAILURE. DISC FATIGUE/WEAR AND RESULTING CONTAMINATION.

- m CRITICALITY 1/1 DURING INTACT ABORT ONLY? NO
- m REDUNDANCY SCREEN A) PASS
 - B) PASS
 - C) FAIL

PASS/FAIL RATIONALE:

- THERMOSTAT CLOSING CAN BE VERIFIED DURING TURNAROUND OR CRYO LOADING.
- TEMP SENSORS ARE ON FOA. LOW LIMIT IS 60 DEG F. BYPASS LINE TEMPERATURE (V46TOXZBA).
- AUGE SYPASS VIBRATION OF THE MOUNTING LINES ON THE APU COULD CAUSE FAILURE OF THE CONTRUL AND OVERTEMPERATURE THERMOSTATS ON BOTH HEATER SYSTEMS
 - m MASTER MEAS. LIST MUMBERS: V46TOX28A V46TOX12A

PRINT DATE: 11/21/91

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CRITICAL FAILURE MODE

NUMBER: 04-2-S17C-[M-01 ATTACHMENT -

PAGE 30 OF 4

፡ V46T0X71A-- | ኢግነ<mark>ል</mark> ፡ V46T0X72A | ኢግኒል

V45TOX92A

- FAILURE EFFECTS -

(A) SUBSYSTEM:
 NO EFFECT ON APU OPERATION. LOSS OF HEATER REDUNDANCY. POSSIBLE LOSS OF SINGLE APU IF FUEL FREEZES.

- (8) INTERFACING SUBSYSTEM(S): NO EFFECT.
- (C) MISSION: LAUNCH SCRUB IF DETECTED. NO EFFECT UNLESS BOTH PRIMARY AND SECONDARY HEATERS FAIL, THEN ABORT.
- (B) CREW, VEHICLE, AND ELEMENT(S): NO EFFECT UNTIL SECOND SYSTEM LOSS. POSSIBLE LOSS OF CREW/VEHICLE DUE TO FIRE/EXPLOSION IF FUEL FREEZES AND LINE RUPTURE OCCURS UPON THANING.
- (E) FUNCTIONAL CRITICALITY EFFECTS:

 FIRST FAILURE NO EFFECT FAILURE OF MEATER SYSTEM WILL BE DETECTABLE

 BY FDA AND RESULT IN CREW SWITCHING TO REDUNDANT HEATER SYSTEM WITHIN

 THE NORMAL RESPONSE TIME OF 15 MINUTES. FAILURE OF REDUNDANT HEATER

 SYSTEM OR COCKPIT SWITCH WILL RESULT IN ORBITER ATTITUDE MANAGEMENT TO

 MAINTAIN SYSTEM THERMAL CONSTRAINTS WITHIN LIMITS (REF FLIGHT RULE

 10-167). FMEA/CIL GROUND RULES DO NOT ALLOW ATTITUDE MANAGEMENT TO BE

 CONSIDERED AS REDUNDANCY. THEREFORE, CRITICALITY IS 1R2.

- DISPOSITION RATIONALE -

(A) DESIGN: THE ELECTRICAL SYSTEM IS DESIGNED WITH (3) DRIVERS THROUGH (PRC) TO TURN OFF THE HEATER. A (3) POLE SWITCH HAS (1) POLE TO EACH DRIVER WHICH ENERGIZES THE CIRCUIT. ANY ONE DRIVER TURNED OFF WILL TURN OFF A HEATER.

THE SWITCH IS DESIGNED TO MEET THE REQUIREMENTS OF WIL-S-24236. IT IS ALL WELDED CONSTRUCTION, CORROSION RESISTANT, SIMPLE, SNAP-ACTING THERMAL SWITCH, HERMETICALLY SEALED WITH DRY WITROGEN. IT IS RATED AT 5 AMPS, BUT CARRIES AMPS.

4

PRINT DATE: 11/21/91

FAILURE MODES EFFECTS AMALYSIS (FMEA) -- CRITICAL FAILURE MODE
MUMBER: 04-2-517C-IM-01



■ (8) TEST:

PART ACCEPTANCE TEST INCLUDES CONTACT RESISTANCE, SEAL TEST, CREEP, AND

IT IS QUALIFIED BY SIMILARITY TO MIL-S-24236 SWITCHES BUILT BY SUNDSTRAND DATA CONTROL. THE SWITCH WAS QUALIFICATION TESTED.

LCC: FORGITISM VERY FIRST BY COCKPIT COMMAND VERIFIES THERMOSTATS (SYSTEM ASSISTED ANY TIME THE FOR FIRST FLIGHT AND ON A CONTINGENCY BASIS THEREAFTER ANY TIME THE LINE, INSULATION, OR HEATER IS DISTURBED.

OVERTEMPERATURE THERMOSTAT CONTACTS BEING CLOSED IS VERIFIED EVERY FLIGHT FOR SYSTEMS A AND B.

(C) INSPECTION:

RECEIVING INSPECTION:

RAW MATERIALS ARE CERTIFIED AND VERIFIED BY INSPECTION. 1ST AND ZOTH RECEIVED SHIPHENTS ARE VERIFIED BY OUT-PLANT AMALYSIS. OTHER SHIPMENTS ARE ACCEPTED ON VENDOR-SUPPLIED CERTIFICATION.

CONTAMINATION CONTROL:

ALL CLEANING OPERATIONS ARE PERFORMED AND INSPECTED PER DOCUMENTED CLEANLINESS REQUIREMENT PROCEDURES. MICROPARTICLE ANALYSIS PERFORMED ON A SAMPLE. PRECAP INSPECTION IS PERFORMED FOR EVERY UNIT.

ASSEMBLY/INSTALLATION:

ALL MANDATORY INSPECTION POINTS FOR MANUFACTURING OPERATIONS ARE VERIFIED AND DOCUMENTED.

NONDESTRUCTIVE EVALUATION:

GROSS LEAK CHECK IS DONE IN FC43 FLUORINERT AND IS VERIFIED BY QUALITY ASSURANCE INSPECTION FOR EVERY UNIT. PARTICLE MOISE IMPACT DETECTION (PIND) TESTING IS PERFORMED AT THE LOWER MODULE ASSEMBLY LEVEL (NOT ATP) FOR EVERY UNIT.

CRITICAL PROCESSES:

VERIFICATION OF CASE WELD IS DONE BY HELIUM LEAK CHECK FOR EVERY UNIT.

TESTING:

TEST EQUIPMENT CALIBRATION IS PER MIL-STD-45662. BURN-IN CYCLING AND ATP ARE PERFORMED AND VERIFIED FOR EVERY UNIT BY INSPECTION.

HANDLING/PACKAGING:

HANDLING, PACKAGING, STORAGE, AND SHIPPING PROCEDURES ARE VERIFIED BY PERIODIC SYSTEM AUDITS.

---- **404** 1

PRINT DATE: 11/21/91

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CRITICAL FAILURE MODE

NUMBER: 04-2-517C-IM-01

\$0502700 ATTACKHENT PAGE 32 OF

(D) FAILURE HISTORY:

CAR 34RF11:

BASELINE APU IN-FLIGHT VIBRATION LEVELS EXCEED SWITCH DESIGN LIMITS AND HAVE RESULTED IN FAILED ON CONDITION, BUT IT COULD ALSO LEAD TO A FAILED OFF CONDITION.

CORRECTIVE ACTION:

A STUDY TO REPLACE THESE SWITCHES ON THE TAPU WITH A VISRATION INSENSITIVE DEVICE IS IN WORK.

(E) OPERATIONAL USE: FAILURE OF THE HEATER SYSTEM IS DETECTABLE BY FDA AND REQUIRES THE CREW MANUALLY SWITCHING TO THE REDUNDANT HEATER SYSTEM.

- APPROVALS -

RELIABILITY ENGINEERING: D. R. ATAPATTU

DESIGN ENGINEERING : J. R. MUNROE

QUALITY MANAGER MASA RELIABILITY

NASA SUBSYSTEM MANAGER :

NASA QUALITY ASSURANCE :

: O. J. BUTTNER Frage 1/4/1-